# Splicing two pigtails




## Overview

Confused about fiber optic pigtails—which connector type, which polish, fusion or mechanical splice?

## Key Takeaways


Fiber optic pigtails are spliced to incoming fiber cables using either fusion or mechanical splicing, with fusion splicing being the most reliable method for low-loss connections.

### Overview of Fiber Optic Pigtails

A fiber optic pigtail is a short length of optical fiber with a factory-terminated connector on one end and a bare fiber on the other. The bare end is designed to be spliced to an incoming fiber cable, while the connector end plugs into equipment, patch panels, or optical distribution frames (ODFs). Pigtails are preferred over field-terminated connectors because they provide factory-grade quality, reduce installation time, and ensure low signal loss.

### Tools and Materials Needed

To splice a fiber optic pigtail, you will need: Fusion Splicer: Uses an electric arc to fuse two fiber ends into a continuous optical path. Fiber Strippers: Remove the outer coating and buffer without damaging the glass core.

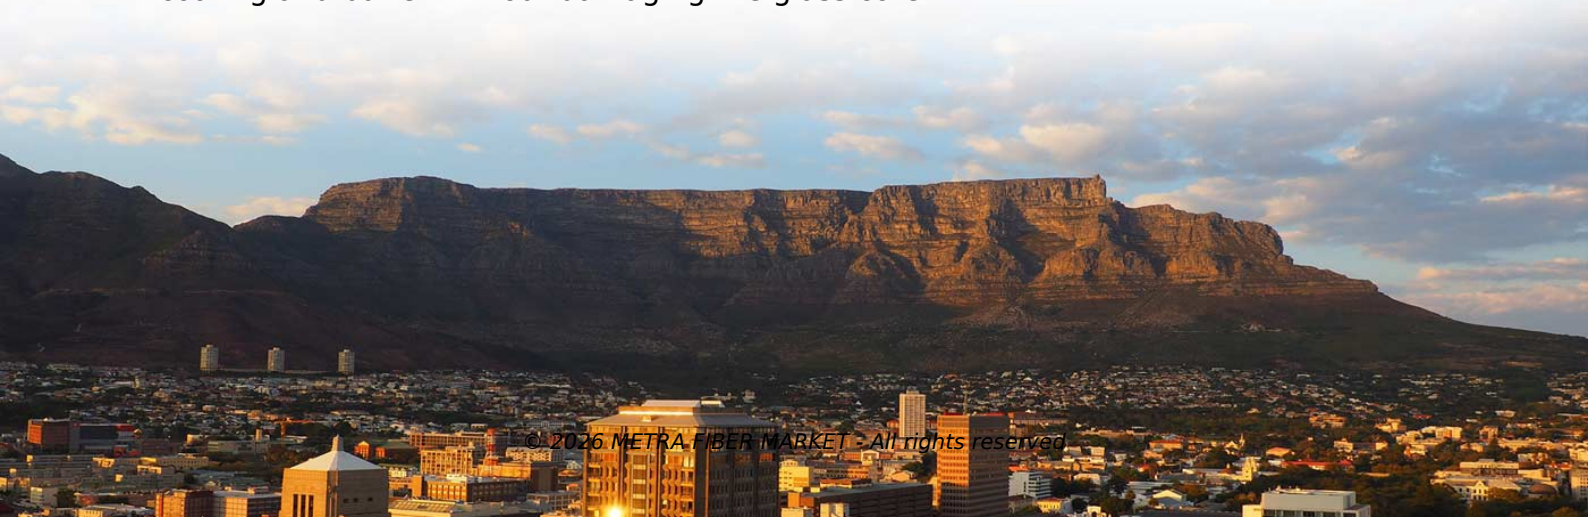

© 2026 METRA FIBER MARKET - All rights reserved

## High-

Precision Cleaver: Cuts the fiber at a perfect 90-degree angle for optimal fusion. Cleaning Supplies: Lint-free wipes and 99% isopropyl alcohol to remove dust and contaminants. Mechanical Splice Kit (optional): Includes alignment devices and index-matching gel for temporary or quick splices.

## Step-by-

## Step Fusion Splicing Process

Prepare the Fiber: Strip the protective coating from both the pigtail and the incoming fiber using fiber strippers. Clean the exposed glass with alcohol wipes to remove dust and oils. Cleave the Fiber: Use a high-precision cleaver to create a flat, perpendicular end on both fibers.

Proper cleaving is critical for low-loss splicing. Align the Fibers: Place the fibers into the fusion splicer. The machine automatically aligns the cores using cameras and precision motors.

Fuse the Fibers: The splicer generates an electric arc to melt and fuse the fiber ends together, creating a continuous optical path with minimal insertion loss (typically around 0. 1 dB). Protect the Splice: Place the fused fiber into a protective sleeve or heat-shrink tube to prevent mechanical damage.

Test the Connection: Use an optical power meter or OTDR (Optical Time-Domain Reflectometer) to verify low signal loss and proper alignment. Mechanical Splicing (Alternative Method)Mechanical splicing is a temporary or quick method where fibers are aligned in a precision holder with index-matching gel to reduce light loss. It is faster but generally has higher insertion loss (~0.

3 dB) and is less permanent than fusion splicing. This method is often used for short-term connections or emergency repairs.

## Best Practices

Always keep fibers clean; even small dust particles can increase signal loss. Ensure proper cleaving; uneven ends lead to higher back reflection and attenuation. Use factory-terminated pigtails to avoid field polishing, which is less reliable.

Label and organize splices in a splice tray to prevent stress and bending of fibers. By following these steps and using the correct tools, splicing fiber optic pigtails can achieve highly reliable, low-loss connections suitable for data centers, FTTH deployments, and telecom networks.

*© 2026 METRA FIBER MARKET - All rights reserved*

## Article Content

Fiber Optic Pigtail: The Complete Guide to Types,

Confused about fiber optic pigtails—which connector type, which polish, fusion or mechanical splice? Our guide covers LC vs SC, APC vs UPC,

How to Splice Fiber Optic Pigtails: A Step-by-Step Guide

Master the art of fiber termination. Learn how to splice fiber optic pigtails using fusion splicing, follow the color code, and ensure low insertion loss.

Fiber Optic Pigtail: Types, Splicing Guide, Specs & Price

Strip the fiber down to bare glass, clean it with 99% isopropyl alcohol, cleave it flat, inspect the end-face, place it in the fusion splicer with the trunk fiber, run the splice cycle, heat-shrink

"Fiber Splicing Pigtails | Step-by-Step Guide for Beginners"

In this detailed video, we''ll walk you through the fiber optic pigtail splicing process — from preparation to final testing.

Fiber Optic Pigtails: Uses & Differences from Patch Cords

In this guide, we will break down what fiber optic pigtails are, how they differ from patch cords, what types exist, and how to select the right one for your project. By the end, you will have a

Tutorial Passive Fiber Optics, Part 6: Fiber Joints

Fiber Pigtails Various optical components such as fiber couplers and laser diodes are often sold with fiber “pigtails”. This means that some fiber hangs out of the device, and the user may splice that to

What is Fiber Pigtail? A Complete Guide for Beginners

Mechanical Splicing is a simple alignment device that allows light to enter from one fiber to the other by holding the ends of the two fibers in precise

Fiber Optic Pigtail: The Backbone of Your Network

This process, known as fusion splicing, uses an electric arc to literally weld the two glass fibers together, creating a nearly seamless connection that minimizes signal loss and back reflection.

Splicing skills of loose sleeve pigtails

*© 2026 METRA FIBER MARKET - All rights reserved*

When splicing loose sleeve pigtails, please strip the sheath a little longer, let the pressure plate press on the coating layer instead of the sheath, and the problem will be solved;

Connections among Fiber Terminal Boxes & Patch Cables & Pigtails

Can the fiber patch cable be divided into two fiber pigtails? Only one end of fiber pigtail is an active connector, while fiber patch cables have active joints on both ends.

What Is Fiber Optic Pigtail and How to Splice It?

While both ends of a fiber patch cord are terminated with fiber optic connectors. Patch cord fibers are usually jacketed, whereas fiber pigtail cables are usually unjacketed for they are

Pigtails

Traditional Fusion Splice-On Connectors with pigtails provide factory-polished performance with field-termination convenience within harsh environments. Mass

Optical fiber cold splicing and hot melting steps

After the two pigtails are pulled out, the cold splicer is used to realize the butt of the two pigtails. It is easier and faster to operate and saves time than welding with a welding machine. With

The Complete Guide to Pigtail Fibers: Simplifying Optical Connectivity

Pigtails vs. Patch Cables: When to Choose Pigtails: Use when one end requires termination (e.g., splicing to a cable trunk). Patch Cables: Ideal for temporary connections between

Master a Perfect Inline Wire Splice Everytime

Master a Perfect Inline Wire Splice Everytime: In this instructable i will teach you how to make a perfect inline wire splice, every timeWhat is an inline splice?Well, if you work with any type of electrical

SC/APC 12-Color Fiber Optic Pigtail Set for Splicing & Termination

12 color-coded SC/APC pigtails with bare fiber ends for easy identification. High-quality ferrule, 100% tested, ideal for termination boxes & equipment connection.

How Do You Splice Fiber with a Fusion Splicer?

In this video and step by step tutorial, we take you through the basic steps on how to fusion splice pigtails using a fusion splicer.

What Is It and How to Splice It

*© 2026 METRA FIBER MARKET - All rights reserved*

While both ends of a fiber patch cord are terminated with fiber optic connectors. Patch cord fibers are usually jacketed, whereas fiber pigtail cables are usually unjacketed for they are usually spliced and

Related Video Reference

This video was associated with the source search result. Verify technical details against current product documentation and project requirements.

## Contact Us

Continue your research online:

Website: https://metramarket.es
Technical inquiry: https://metramarket.es/contact.html

This document is for preliminary research. Verify specifications against current standards, product documentation and project requirements.

© 2026 METRA FIBER MARKET - All rights reserved